

Date: Tuesday, 14/10/2008 3:40:41 PM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	212/205 HIGH FED X-TUBE ASSEMBLY
Job Number :	42601		
Estimate Number :	13216		
P.O. Number :		Part Number :	D212664101TRN
This Issue :	14/10/2008	Drawing Number :	D212-664-141 REV C
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	//	Drawing Revision :	C
Previous Run :	42306	Material :	
Written By :		Due Date :	21/10/2008
Checked & Approved By :	Qty: 1 Um: Each		
Comment :	Est Rev: A 08-03-06 new issue DD verified by: ec Est Rev B 08.04.02 removed Polish EC verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	D6005128	Crosstube Material
Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) Pick: Qty Part number Description Batch 1 D6005-128 Crosstube B34775 Check OD = 2.750", ID = 2.000"		
2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
Comment: MORI SEIKI CNC LATHE LARGE 1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA113 2-Turn first side as per Folio FA113 3-File down transition lines smooth.		
3.0	QC1	INSPECT ALL DIM TO DIM SHEET
Comment: INSPECT ALL DIM TO DIM SHEET		
4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
Comment: MORI SEIKI CNC LATHE LARGE 1-Turn second side as per Folio FA113 2-File down transition lines smooth. 3-Remove sand and plugs		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 3:40:41 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 42601

Part Number: D212664101TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

Q.m 08-10-23

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

AWM 8-10-23

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM / MB 8-10-27

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 8-10-27

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock in kanban rack

Location: *landing gear*

MF 08-10-27

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/10/27

Job Completion



MF 08-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 42601
Description: Crosstube Assembly (205/212/412 High Fwd)		Part Number: D212-664-141
Inspection Dwg: D212-664-141 Rev: C		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	0.200	✓			
	R0.063	+/-0.010	R0.063	✓			
	2.740	+0.005/-0.000	2.742	✓			
	5.097	+/-0.030	5.097	✓			
	2.304	+0.005/-0.000	2.307	✓			
	2.340	+0.005/-0.000	2.345	✓			
	2.398	+0.005/-0.000	2.402	✓			
	2.448	+0.005/-0.000	2.452	✓			
	2.498	+0.005/-0.000	2.502	✓			
	2.549	+0.005/-0.000	2.552	✓			
	2.599	+0.005/-0.000	2.603	✓			
	2.671	+0.005/-0.000	2.676	✓			
	2.701	+0.005/-0.000	2.706	✓			
SIDE B	0.200	+/-0.010	0.200	✓			
	R0.063	+/-0.010	R0.063	✓			
	2.740	+0.005/-0.000	2.742	✓			
	5.097	+/-0.030	5.097	✓			
	2.304	+0.005/-0.000	2.307	✓			
	2.340	+0.005/-0.000	2.345	✓			
	2.398	+0.005/-0.000	2.402	✓			
	2.448	+0.005/-0.000	2.452	✓			
	2.498	+0.005/-0.000	2.502	✓			
	2.549	+0.005/-0.000	2.552	✓			
	2.599	+0.005/-0.000	2.603	✓			
	2.671	+0.005/-0.000	2.676	✓			
	2.701	+0.005/-0.000	2.706	✓			
	126.51	+/-0.020	126.510	✓			

Measured by: A.W	Audited by: A.W.M	Prototype Approval: N/A
Date: 08.10.23	Date: 08-10-23	Date: N/A

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-101)	KJ/JLM	
B	06.03.15	Tolerance revised for 5.097 per Dwg Rev update	KJ/JLM	
C	07.05.28	Dwg Rev updated	KJ/JLM	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED GP	APPROVED [Signature]	DRAWING NO. D212-664-141	REV. C SHEET 1 OF 3
DATE 07.03.08		TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE NTS
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	07.03.08	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	

RELEASED

07.04.24 **[Signature]**

Qty	Part Number	Description
X	D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
1	D6005-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
4	MS21920-25	CLAMP (OR MS21920-26)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.51±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 10) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **42601**

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 3:40:43 PM
 User: Julie Lecocq

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 212/205 HIGH FED X-TUBE ASSEMBLY
Job Number	: 42602		
Estimate Number	: 13216		
P.O. Number	:	Part Number	: D212664101TRN
This Issue	: 14/10/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D212-664-141 REV C
First Issue	: //	Project Number	: N/A
Previous Run	: 42601	Drawing Revision	: C
		Material	:
Written By	:	Due Date	: 21/10/2008
Checked & Approved By	: <u>JUL 08 10 14</u>	Qty:	1 Um: Each
Comment	: Est Rev:A 08-03-06 new issue DD verified by:ec Est Rev B 08.04.02 removed Polish EC verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	D6005128	Crosstube Material
Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s) Pick: Qty Part number Description Batch 1 D6005-128 Crosstube <u>B34775</u> Check OD = 2.750"; ID = 2.000" <u>A.m 08.10.23 6</u>		
2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
Comment: MORI SEIKI CNC LATHE LARGE 1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA113 2-Turn first side as per Folio FA113 3-File down transition lines smooth. <u>A.m 08.10.23 6</u>		
3.0	QC1	INSPECT ALL DIM TO DIM SHEET
Comment: INSPECT ALL DIM TO DIM SHEET <u>A.m 08.10.23 6</u>		
4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
Comment: MORI SEIKI CNC LATHE LARGE 1-Turn second side as per Folio FA113 2-File down transition lines smooth. 3-Remove sand and plugs <u>A.m 08.10.23 6</u>		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 3:40:43 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212/205 HIGH FED X-TUBE ASSEMBLY

Job Number: 42602

Part Number: D212664101TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0 QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

Q.m 08.10.23 (1)

6.0 QC8

SECOND CHECK



Comment: SECOND CHECK

AWM 8-10-24

7.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM / MF 08-10-27

8.0 QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DD 8-10-27

9.0 PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock in kanban rack

Location: *Landing gear*

MF 08-10-27

10.0 QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/10/27

Job Completion



MF 08-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 42602
Description: Crosstube Assembly (205/212/412 High Fwd)		Part Number: D212-664-141
Inspection Dwg: D212-664-141 Rev: C		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	0.200	/		
	R0.063	+/-0.010	R0.063	/		
	2.740	+0.005/-0.000	2.742	/		
	5.097	+/-0.030	5.097	/		
	2.304	+0.005/-0.000	2.309	/		
	2.340	+0.005/-0.000	2.343	/		
	2.398	+0.005/-0.000	2.402	/		
	2.448	+0.005/-0.000	2.452	/		
	2.498	+0.005/-0.000	2.502	/		
	2.549	+0.005/-0.000	2.553	/		
	2.599	+0.005/-0.000	2.603	/		
	2.671	+0.005/-0.000	2.676	/		
	2.701	+0.005/-0.000	2.706	/		
SIDE B	0.200	+/-0.010	0.200	/		
	R0.063	+/-0.010	R0.063	/		
	2.740	+0.005/-0.000	2.743	/		
	5.097	+/-0.030	5.097	/		
	2.304	+0.005/-0.000	2.309	/		
	2.340	+0.005/-0.000	2.343	/		
	2.398	+0.005/-0.000	2.403	/		
	2.448	+0.005/-0.000	2.452	/		
	2.498	+0.005/-0.000	2.502	/		
	2.549	+0.005/-0.000	2.553	/		
	2.599	+0.005/-0.000	2.604	/		
	2.671	+0.005/-0.000	2.676	/		
	2.701	+0.005/-0.000	2.706	/		
	126.51	+/-0.020	126.510	/		

Measured by: A.M.	Audited by: ANN	Prototype Approval:	N/A
Date: 08.10.23	Date: 8-10-24	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-101)	KJ/JLM	
B	06.03.15	Tolerance revised for 5.097 per Dwg Rev update	KJ/JLM	
C	07.05.28	Dwg Rev updated	KJ/JLM	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED QP	APPROVED [Signature]	DRAWING NO. D212-664-141	REV. C SHEET 1 OF 3
DATE 07.03.08		TITLE XTUBE ASS'Y (205/212/412 HI FWD) NTS	
A	00.12.12	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	07.03.08	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	

RELEASED

07.04.24

Qty	Part Number	Description
X	D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
1	D6005-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
4	MS21920-25	CLAMP (OR MS21920-26)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.51±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 10) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42602

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____



Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


RELEASED
67.04.24 (P)
PER ELN 887

DETAIL A: CROSSTUBE CUFF

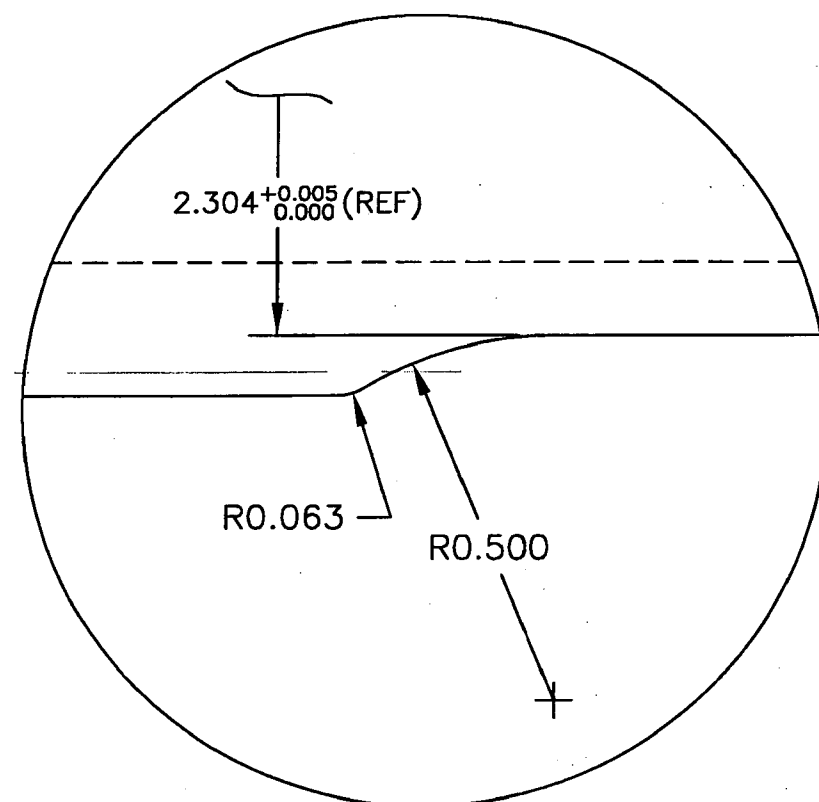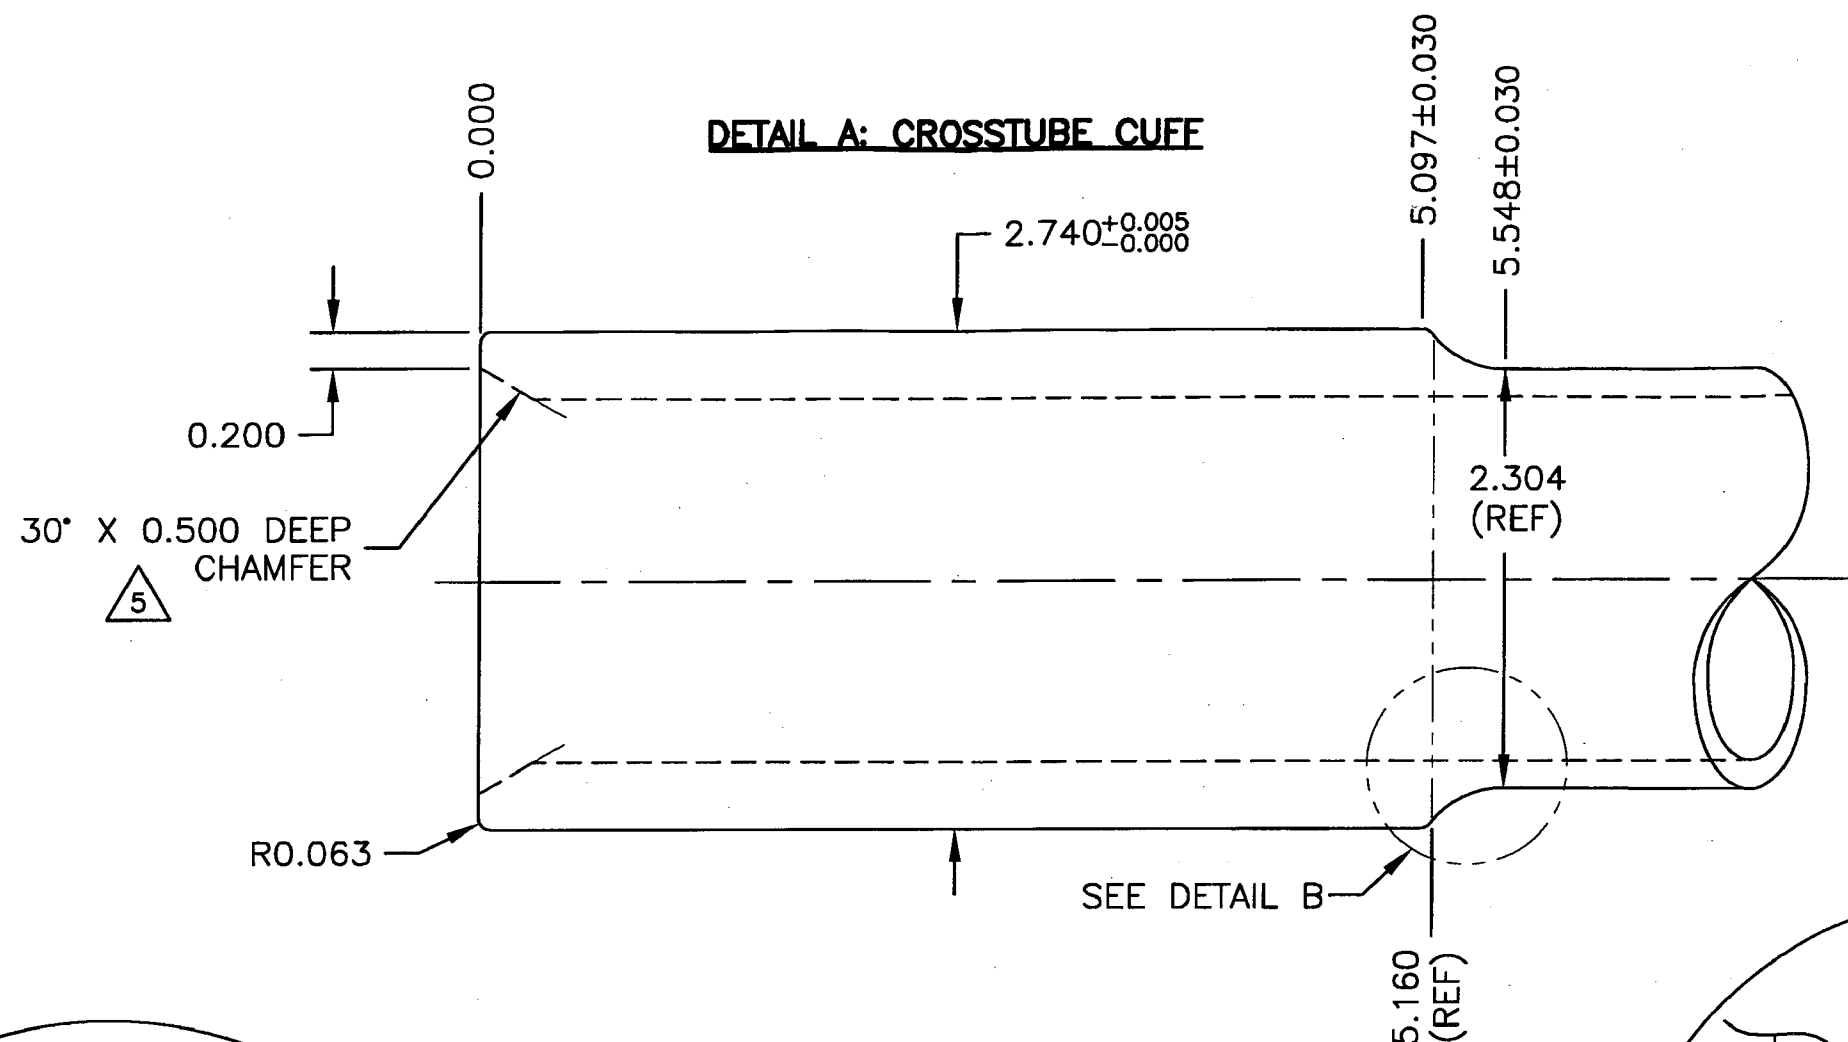

**DETAIL B: CUFF
TRANSITION**
SCALE 4:1

**DETAIL C:
TAPER RUN-OFF**
NOT TO SCALE





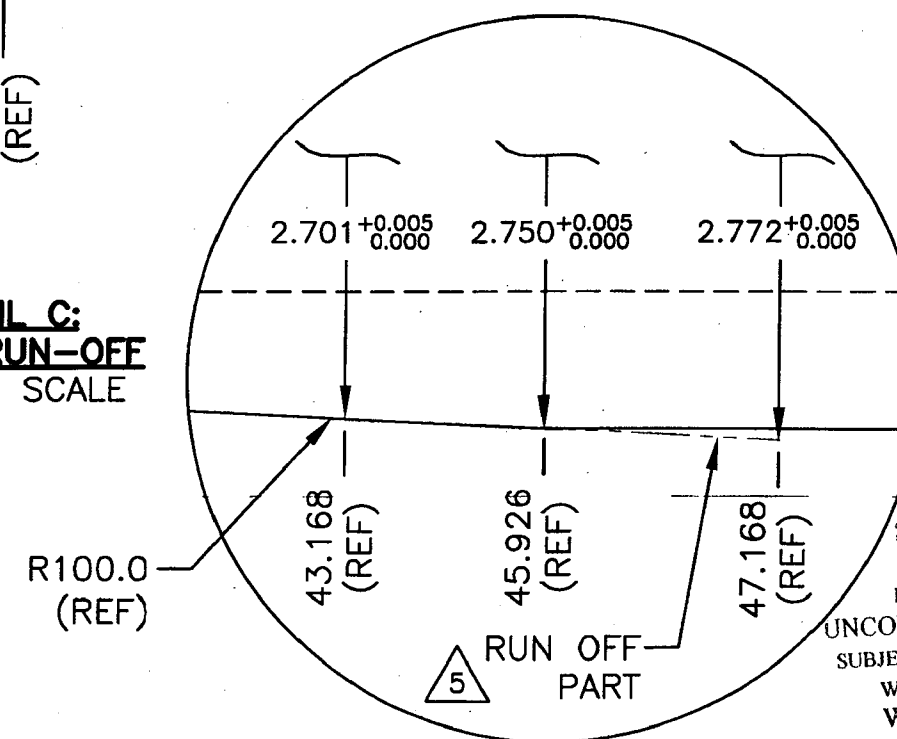


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42602

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	DART	DART AEROSPACE LTD. HAMKESBURY, ONTARIO, CANADA
CHECKED J	APPROVED [Signature]	DRAWING NO. D212-664-141	REV. C SHEET 3 OF 3
DATE 07.03.08	TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE 1:1	

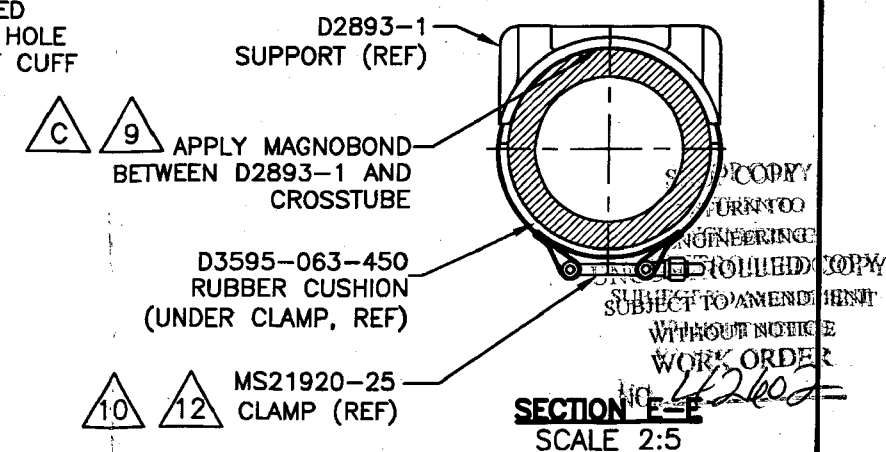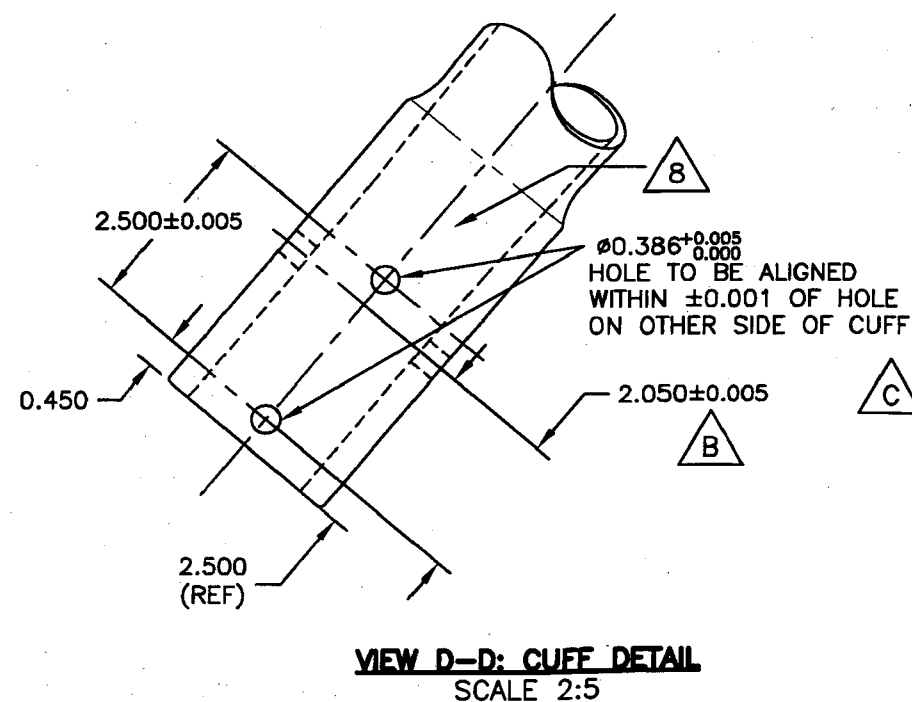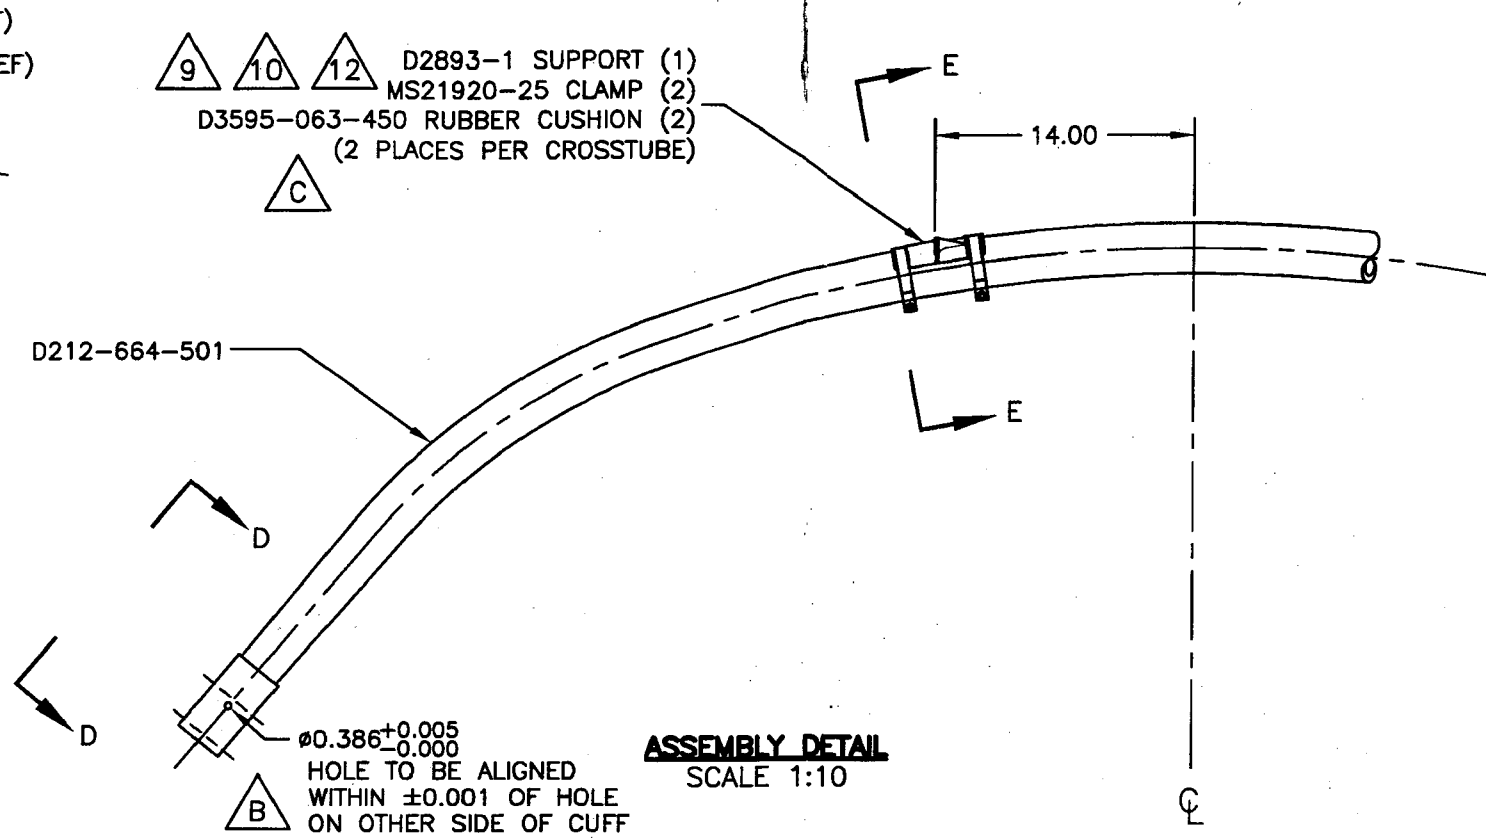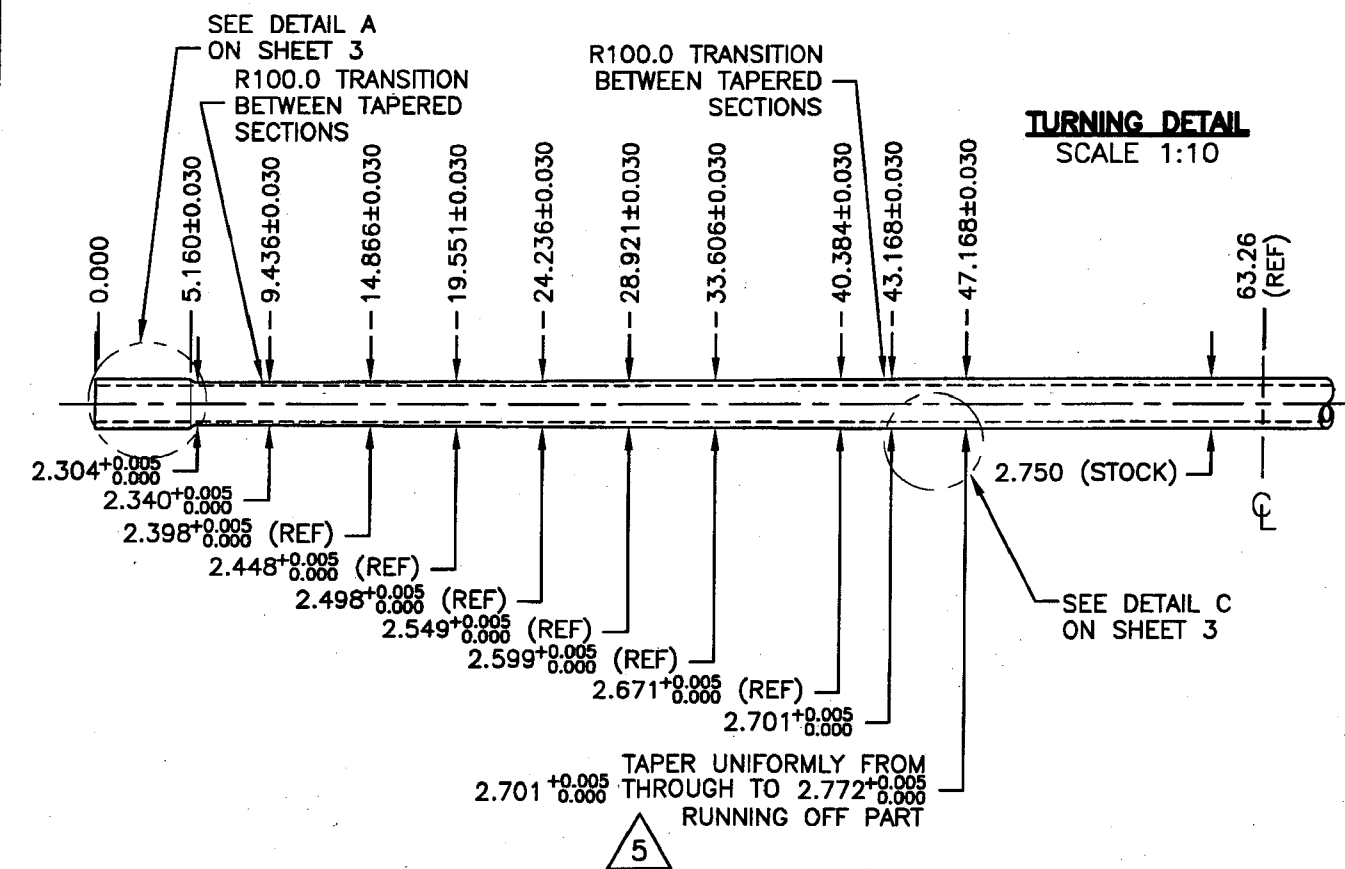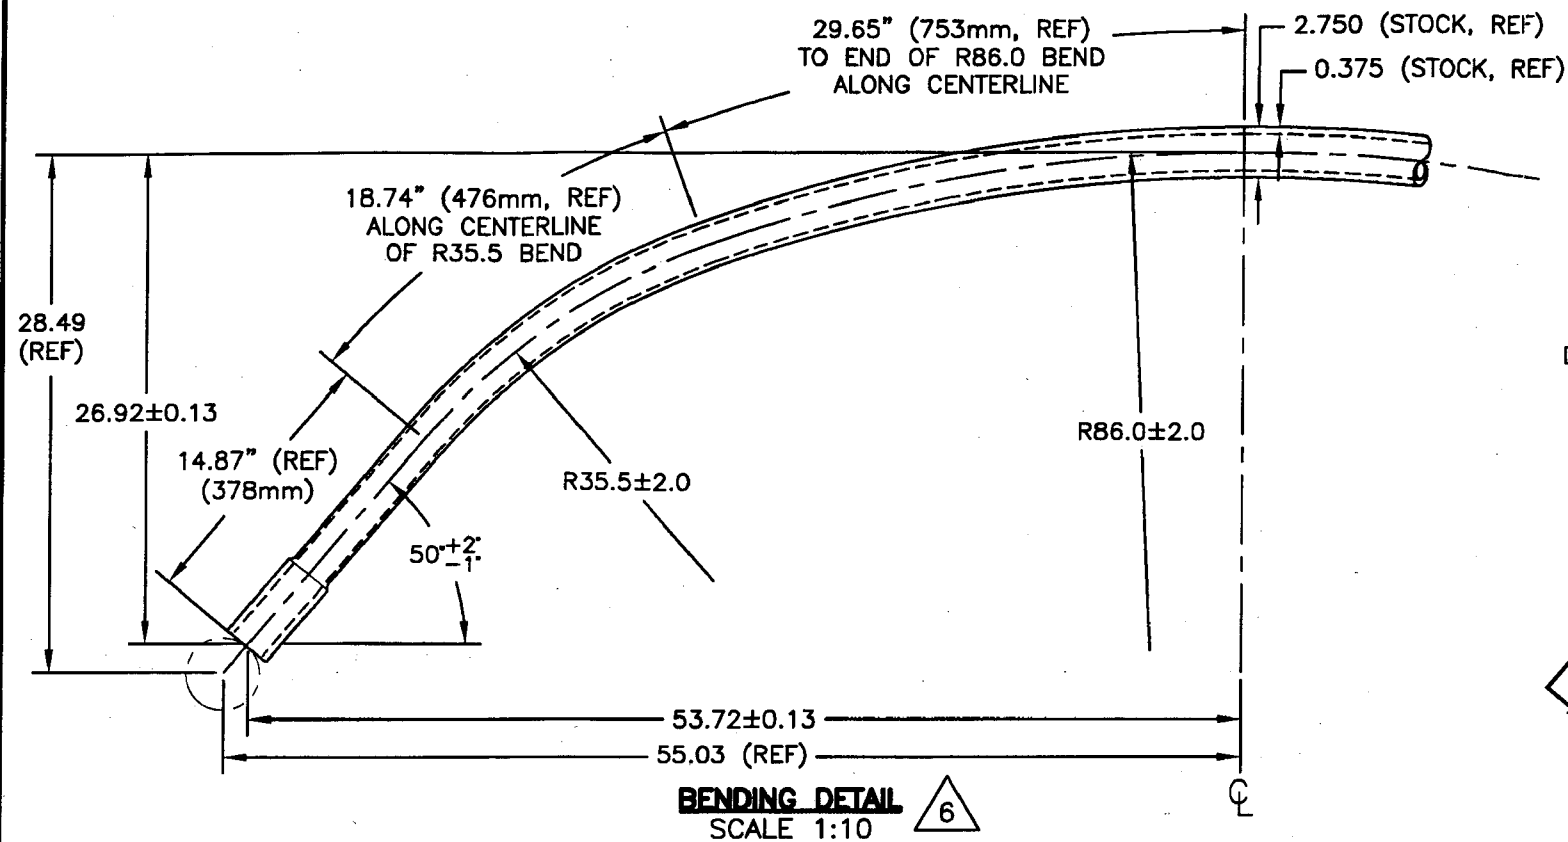

RELEASED

07.04.24



COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED	GP	APPROVED	PH	DRAWING NO.	REV. C
DATE	07.03.08			D212-664-141	SHEET 2 OF 3
				TITLE	SCALE
				XTUBE ASS'Y (205/212/412 HI FWD)	1:10


RELEASED
67.04.24 (P)
PER E.L.N. 987

DETAIL A: CROSSTUBE CUFF

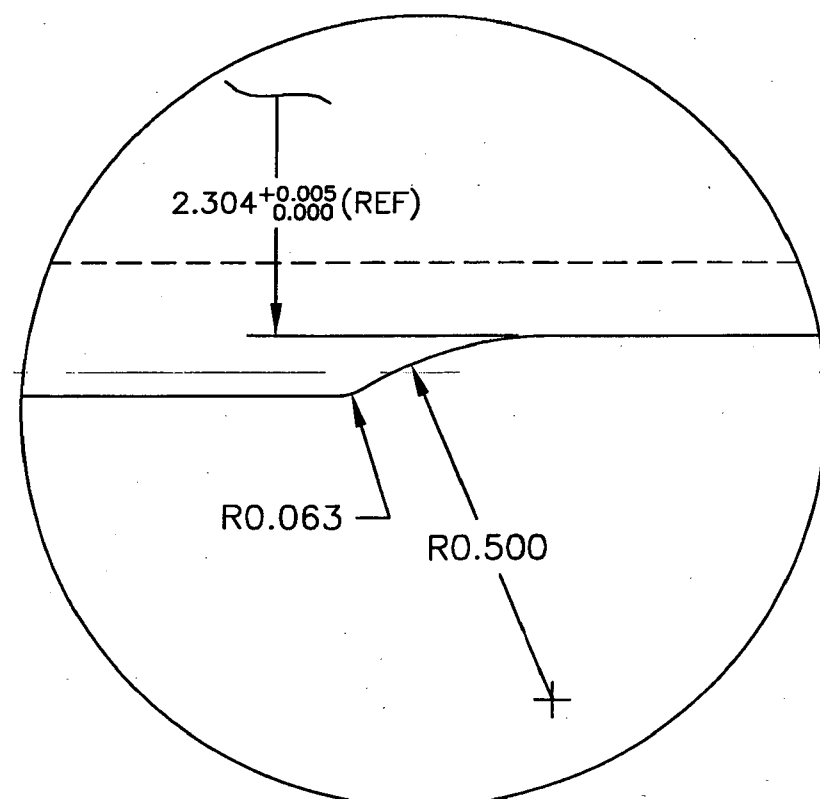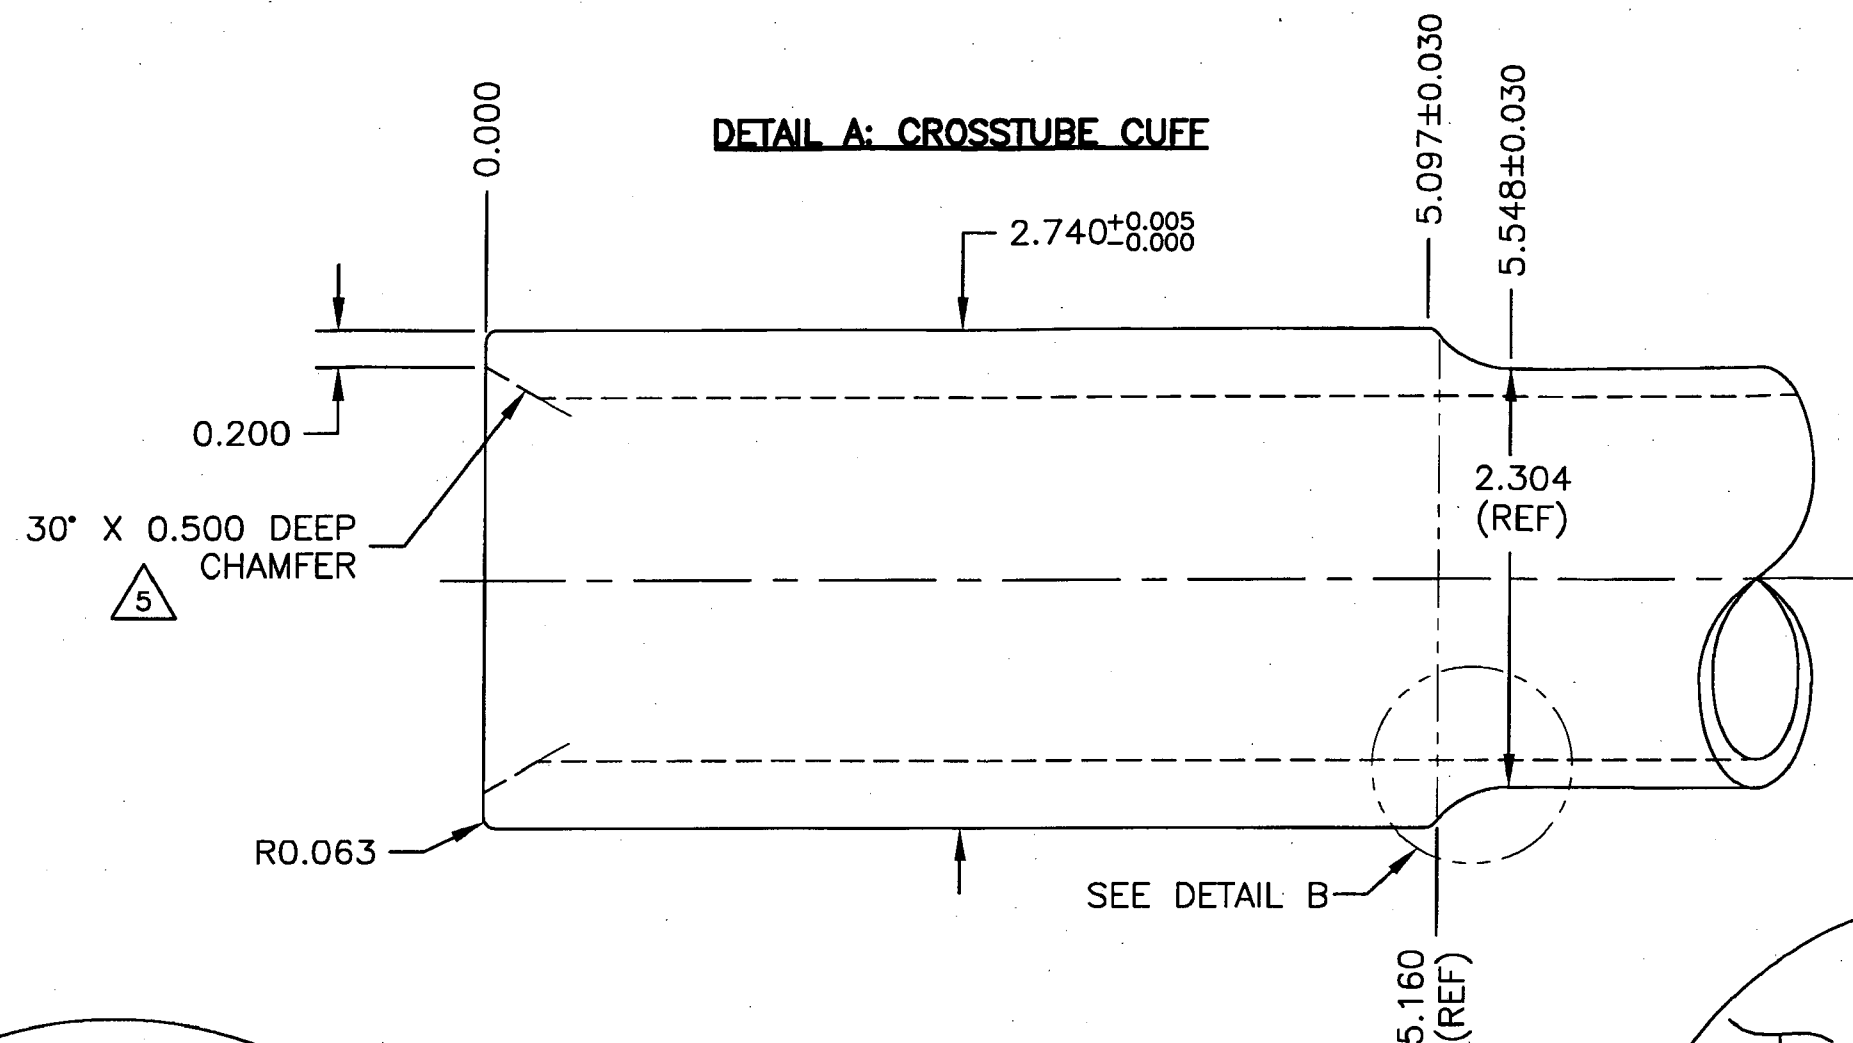

**DETAIL B: CUFF
TRANSITION**
SCALE 4:1

**DETAIL C:
TAPER RUN-OFF**
NOT TO SCALE




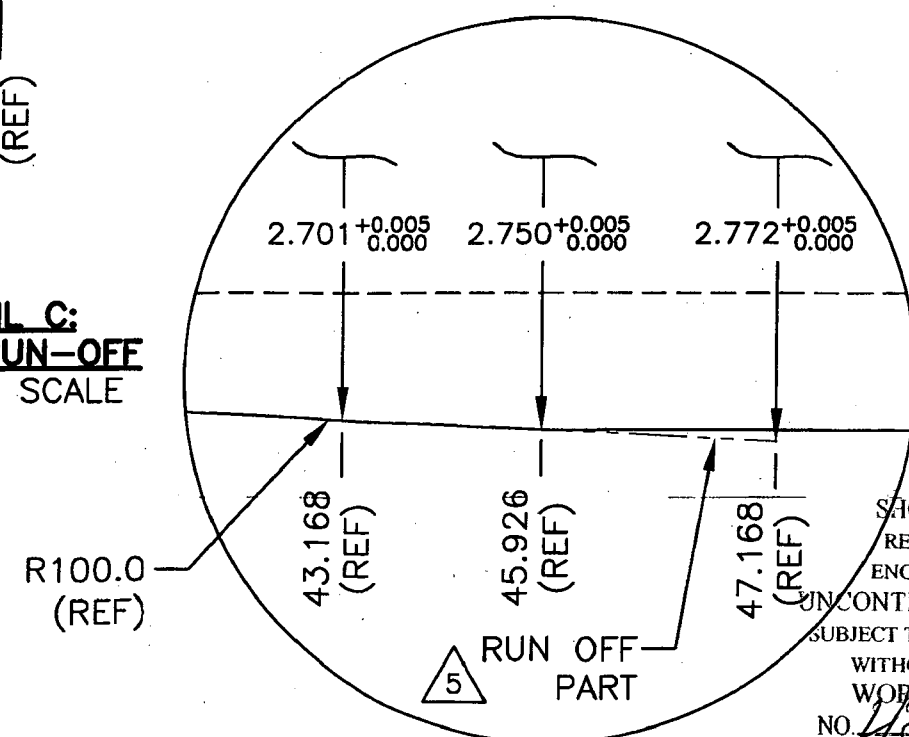


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42601

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED J	APPROVED J	DRAWING NO. D212-664-141	REV. C SHEET 3 OF 3
DATE 07.03.08	TITLE XTUBE ASS'Y (205/212/412 HI FWD)	SCALE 1:1	

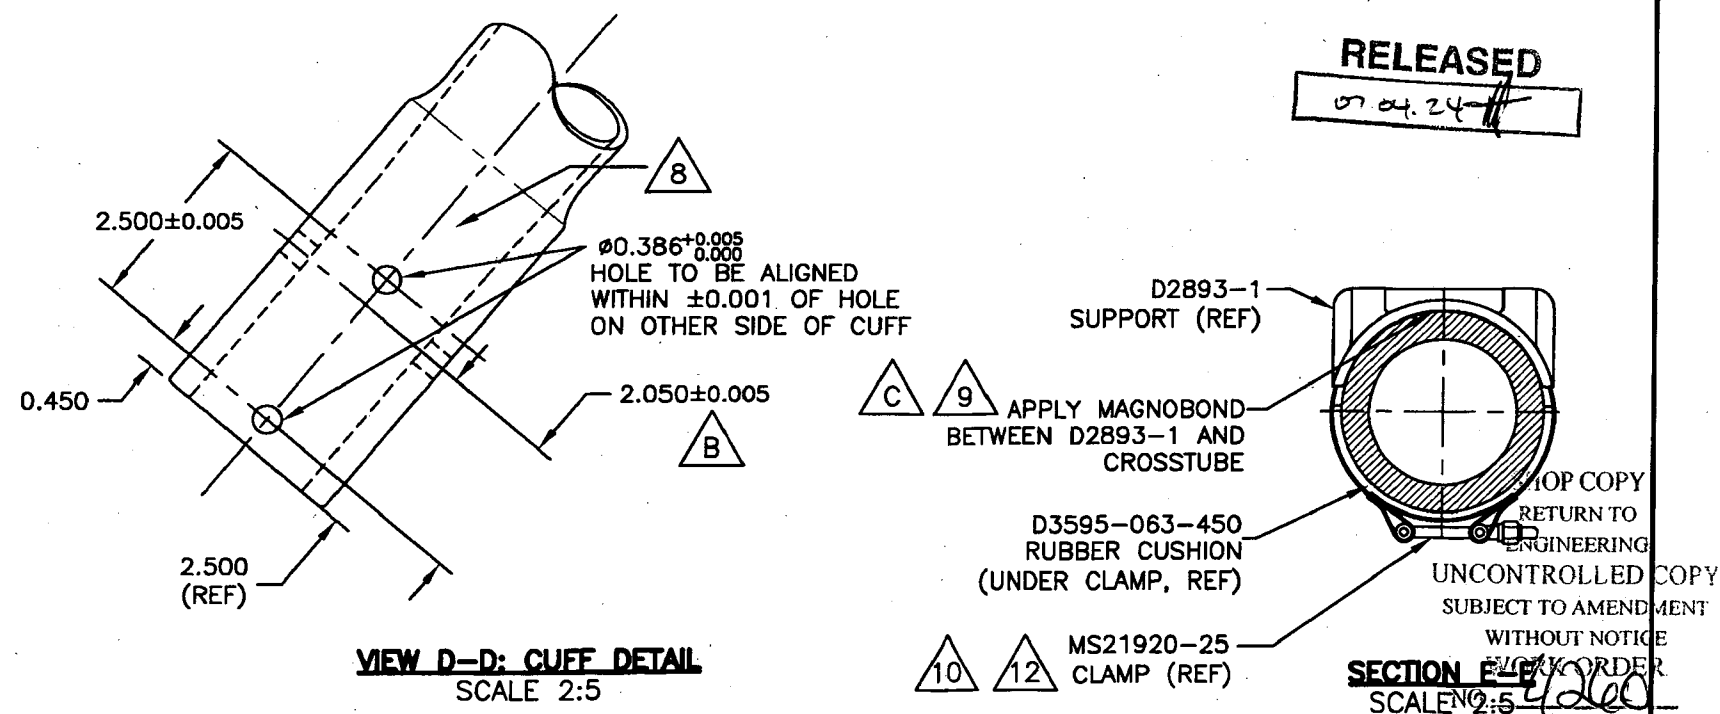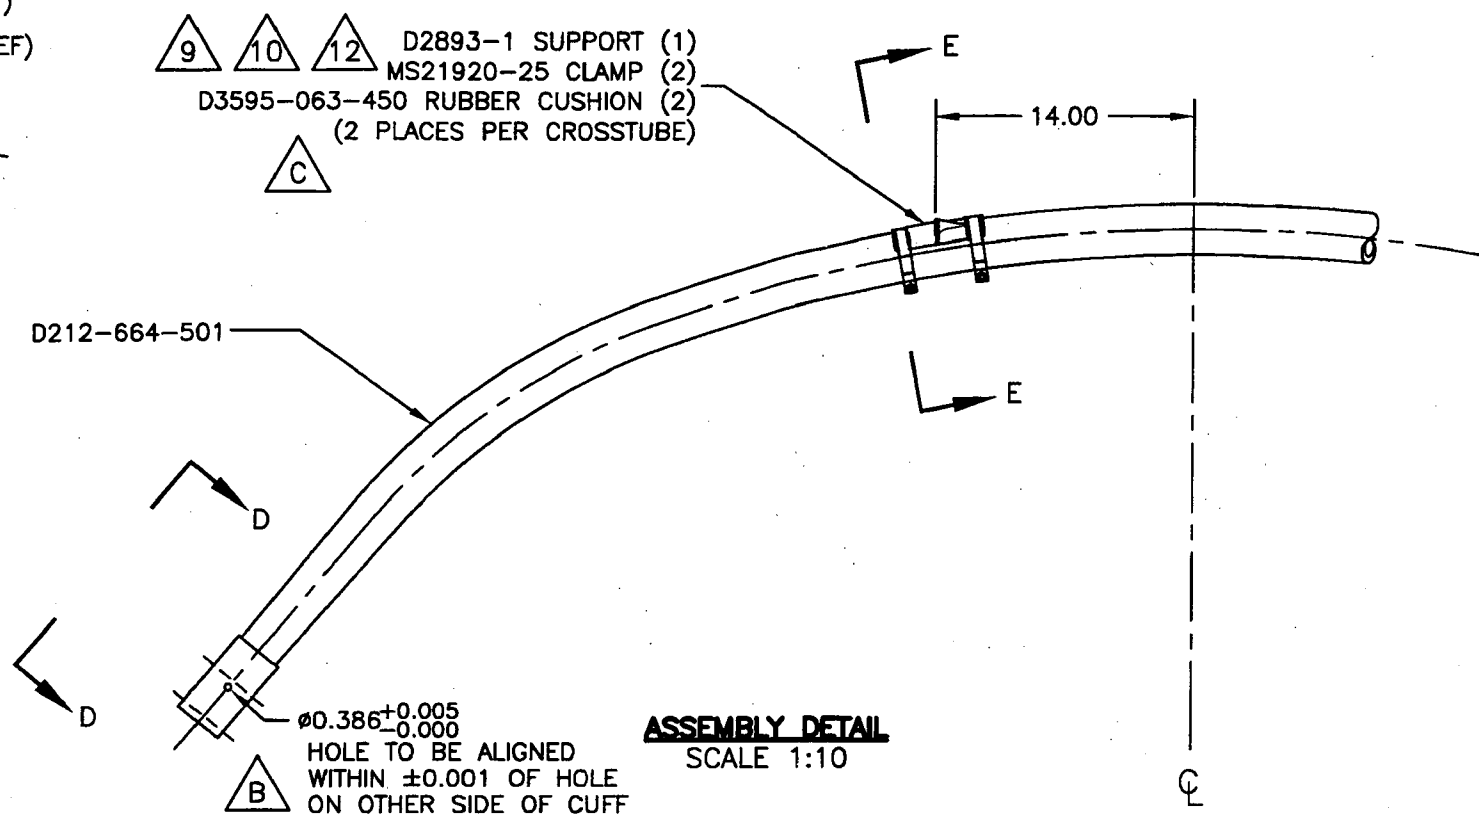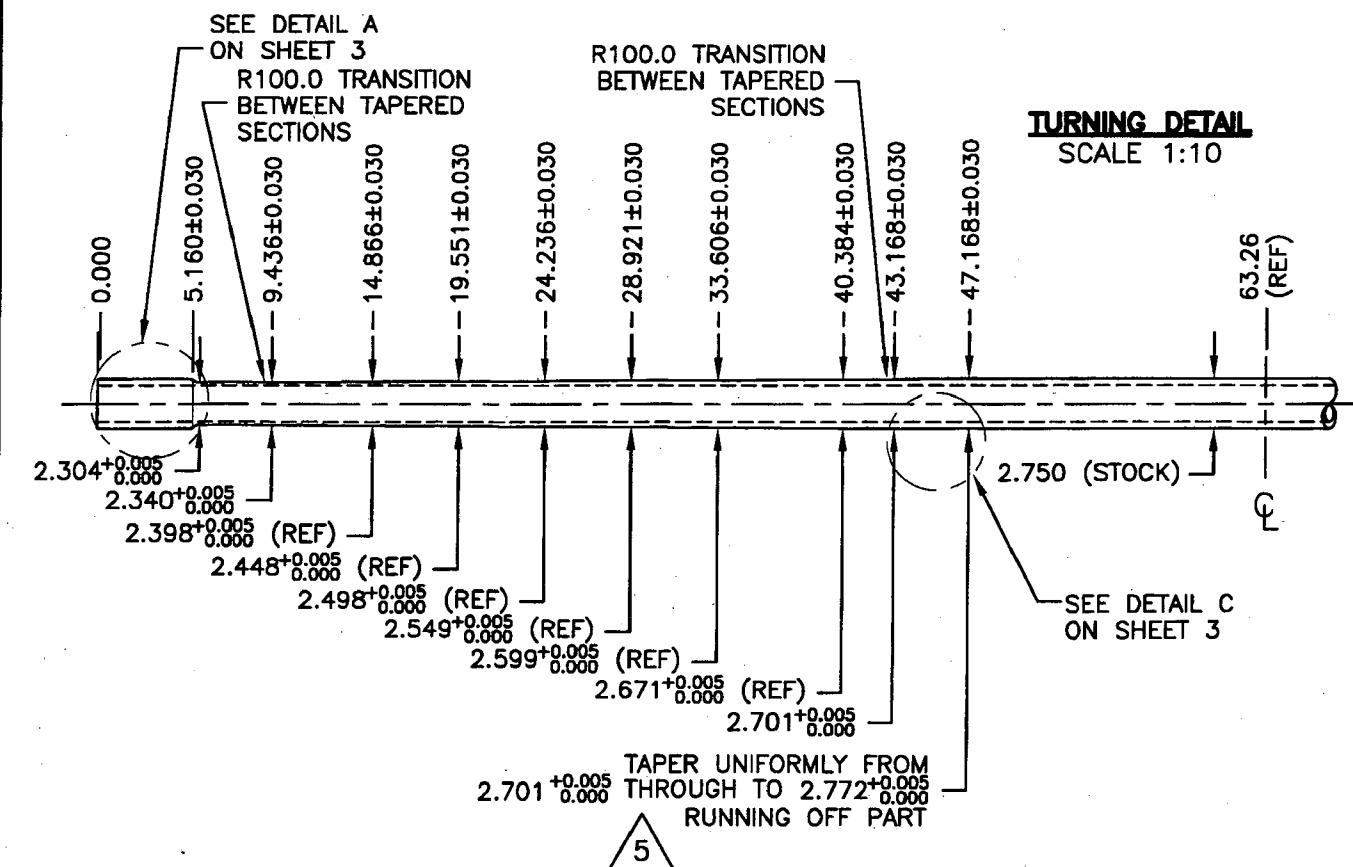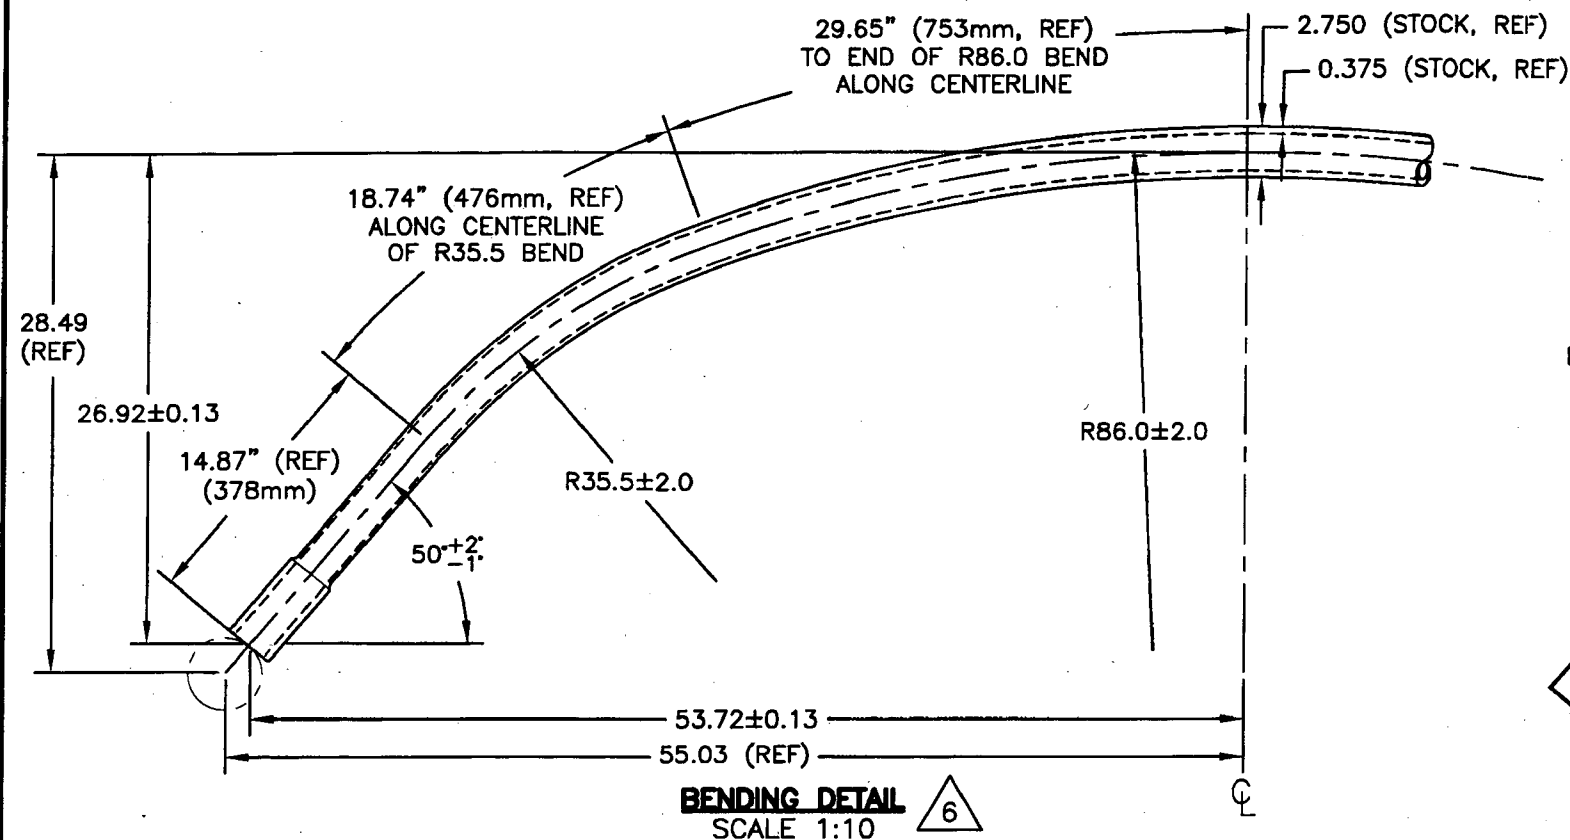

RELEASED
07.04.24

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	92	APPROVED	PH	DRAWING NO.	REV. C
		DATE	07.03.08			D212-664-141	SHEET 2 OF 3
		TITLE	XTUBE ASS'Y (205/212/412 HI FWD) 1:10				SCALE